

South Texas Project Electric Generating Station P.O. Box 289 Wadsworth, Texas 77483

February 28, 2013 NOC-AE-13002974 File No.: G25

10 CFR 50.73 STI: 33661623

U. S. Nuclear Regulatory Commission Attention: Document Control Desk Washington, DC 20555-0001

South Texas Project
Unit 2
Docket No. STN 50-499
Licensee Event Report 2-2013-001
Unit 2 Manual Reactor Trip Due to Dropped Rods M8 and D8

Pursuant to 10 CFR 50.73, STP Nuclear Operating Company (STPNOC) submits the attached Unit 2 Licensee Event Report (LER) 2-2013-001 to address the Unit 2 Manual Reactor trip that occurred on January 4, 2013.

This condition is considered reportable under 10 CFR 50.73(a)(2)(iv)(A), any event or condition that resulted in manual or automatic actuation of any of the systems listed in paragraph (a)(2)(iv)(B) of this section.

This event did not have an adverse effect on the health and safety of the public.

There are no commitments contained in this LER. Corrective actions will be implemented in accordance with the STP Corrective Action Program.

If there are any questions on this submittal, please contact either Jamie Paul at (361) 972-7344 or me at (361) 972-7800.

Dennis L. Koehl

President and CEO/CNO

JLP

Attachment: LER 2-2013-001

cc:

(paper copy)

Regional Administrator, Region IV U. S. Nuclear Regulatory Commission 1600 East Lamar Blvd Arlington, Texas 76011-4511

Balwant K. Singal Senior Project Manager U.S. Nuclear Regulatory Commission One White Flint North (MS 8B1) 11555 Rockville Pike Rockville, MD 20852

Senior Resident Inspector
U. S. Nuclear Regulatory Commission
P. O. Box 289, Mail Code: MN116
Wadsworth, TX 77483

C. M. Canady
City of Austin
Electric Utility Department
721 Barton Springs Road
Austin, TX 78704

(electronic copy)

A. H. Gutterman, Esquire Morgan, Lewis & Bockius LLP

Peter Nemeth Crain Caton & James, P.C.

John Ragan Chris O'Hara Jim von Suskil NRG South Texas LP

Kevin Pollo Richard Pena City Public Service

C. Mele City of Austin

Richard A. Ratliff Texas Department of State Health Services

Alice Rogers Texas Department of State Health Services

Balwant K. Singal U. S. Nuclear Regulatory Commission

U.S. NUCLEAR REGULATORY COMMISSION  (10-2010)  LICENSEE EVENT REPORT (LER)  (See reverse for required number of digits/characters for each block)  1. FACILITY NAME South Texas Unit 2  4. TITLE  Unit 2 Manual Reactor Trip Due						APPROVED BY OMB: NO, 3150-0104 EXPIRES: 10/31/2013 Estimated burden per response to comply with this mandatory collection request: 80 hours. Reported lessons learned are incorporated into the licensing process and fed back to industry. Send comments regarding burden estimate to the FOIA/Privacy Section (T-5 F53). U.S. Nuclear Regulatory Commission, Washington. DC 20555-0001, or by internet e-mail to Infocollects. resource@nrc.gov, and to the Desk Officer, Office of Information and Regulatory Affairs. NEOB-10202. (3150-1104), Office of Management and Budget. Washington. DC 20503. If a means used to impose an information collection does not display a currently valid OMB control number, the NRC may not conduct or sponsor, and a person is not required to respond to the information collection.  2. DOCKET NUMBER  05000499  1 OF 4							
5. EVE	NT DATE	<u> </u>	6. LER	6. LER NUMBER 7. REPO			ORT DATE 8. OTHER FA			ACILITIES INVO	CILITIES INVOLVED		
MONTH	DAY	YEAR	YEAR	SEQUENTIA NUMBER	L REV NO.	MONTH	DAY	YEAR	8. OTHER FACILITIES INVOLVED  FACILITY NAME DOCKET NUMBER  N/A N/A		UMBER		
01	04	2013	2013	001	0	02	28	2013	N/A		N/A		
9. OPERATING MODE  1  10. POWER LEVEL  100%			20 20 20 20 20 20 20 20 20	20.2201(b)			THE REQUIREMENTS OF 10CFR§: (Check all that apply)   □ 50.73(a)(2)(i)(C) □ 50.73(a)(2)(vii) □ 50.73(a)(2)(ii)(A) □ 50.73(a)(2)(viii)(A) □ 50.73(a)(2)(ii)(B) □ 50.73(a)(2)(viii)(B) □ 50.73(a)(2)(iii) □ 50.73(a)(2)(ix)(A) □ 50.73(a)(2)(iv)(A) □ 50.73(a)(2)(x) □ 50.73(a)(2)(v)(A) □ 73.71(a)(4) □ 50.73(a)(2)(v)(B) □ 73.71(a)(5) □ 50.73(a)(2)(v)(C) □ OTHER □ 50.73(a)(2)(v)(D) Specify in Abstract below or in NRC Form 366A						
FACILITY N	JAME			12.	LICENSEE C	ONTACT	OR THIS	LER	Ĭ	TELEPHONE NI	IMBER (Include	Area Codel	
Jamie Paul, Licensing Supervisor 361-972-7344													
	13. COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT												
			FACTURER EPIX		E 10 CA	USE S	SE SYSTEM COMPONENT		MANU- FACTURER	REPORTABLE TO EPIX			
X	X AA NO G223 Y												
	YES (if yes, complete 15. EXPECTED SUBMISSION DATE)  VES (if yes, complete 15. EXPECTED SUBMISSION DATE)							YEAR					
13. COMPLETE ONE LINE FOR EACH COMPONENT FAILU  CAUSE SYSTEM COMPONENT MANU- FACTURER EPIX  X AA HS G223 Y  14. SUPPLEMENTAL RESPONSE EXPECTED				USE S	15. EXPEC	COMPONENT	MANU-						

At 07:05 on 1/4/2013, Unit 2, while at 100% power, commenced surveillances 0PSP03-RS-0004 and 0PSP03-RS-0001 to satisfy the monthly requirements of Technical Specification 4.1.3.1.2. and to demonstrate the shutdown and control rods are Operable by movement of at least 10 steps in any one direction.

During testing, two rods on shutdown bank E (SBE) dropped to the bottom of the core and a manual reactor trip was required. The dropped rods on SBE occurred while inserting shutdown bank C (SBC) rods in 6 steps. After SBE rod M-8 dropped, rod motion was stopped. While validating the dropped rod, a second rod, D-8, in SBE dropped. At 09:41, once both dropped rods were validated by diverse indications of power, flux, and rod positions, a manual reactor trip was performed. Troubleshooting identified the problem as high resistance on Rod Holdout Mode Selector (RHMS) switch contacts in Rod Control Power Cabinet SCDE when the contacts should have been closed. This blocked the multiplexing signal to the SBE Stationary Regulation card resulting in dropped rods.

This condition is considered reportable under 10 CFR 50.73(a)(2)(iv)(A), any event or condition that resulted in manual or automatic actuation of any of the systems listed in paragraph 10 CFR 50.73(a)(2)(iv)(B). There were no personnel injuries, no offsite radiological releases, and no damage to safety-related equipment associated with this condition. This condition did not have an adverse effect on the health and safety of the public.

NRC FORM 366A	LICENSEE EVENT CONTINUATION	•	ER) U.S. NI	U.S. NUCLEAR REGULATORY COMMISSION		
1. FACILITY NAME	2. DOCKET	6. LE	R NUMBER		3. PAGE	
Couth Toyon Unit 2	05000499	YEAR	SEQUENTIAL NUMBER	REV. NO	2 OF 4	
South Texas Unit 2	03000499	2013	001	00	-	

# I. DESCRIPTION OF EVENT

# A. REPORTABLE EVENT CLASSIFICATION

This event is reportable pursuant to 10 CFR 50.73(a)(2)(iv)(A), any event or condition that resulted in manual or automatic actuation of any of the systems listed in paragraph (a)(2)(iv)(B) of this section.

#### B. PLANT OPERATING CONDITIONS PRIOR TO EVENT

South Texas Project (STP) Unit 2 was in Mode 1, with Reactor Power at approximately 100%.

# C. STATUS OF STRUCTURES, SYSTEMS, AND COMPONENTS THAT WERE INOPERABLE AT THE START OF THE EVENT AND THAT CONTRIBUTED TO THE EVENT

No structures, systems, or components were inoperable at the start of the event that contributed to the event.

# D. NARRATIVE SUMMARY OF THE EVENT

At 07:05 on 1/4/2013, Unit 2, while at 100% power, the control room commenced 0PSP03-RS-0001 "MONTHLY CONTROL ROD OPERABILITY", and 0PSP03-RS-0004 "CONTROL ROD OPERABILITY (6 AND 10 STEPS)". Surveillances 0PSP03-RS-0004 and 0PSP03-RS-0001 test the shutdown and control rods not fully inserted in the core in order to satisfy the monthly requirements of Technical Specification 4.1.3.1.2. and also provide instructions for demonstrating the shutdown and control rods not fully inserted in the core are Operable by movement of at least 10 steps in any one direction.

During testing, two rods on shutdown bank E (SBE) dropped to the bottom of the core and a manual reactor trip was required per 0POP04-RS-0001, "CONTROL ROD MALFUNCTION". The dropped rods on SBE occurred while inserting shutdown bank C (SBC) rods in 6 steps. When SBC demand reached 255, one rod in SBE dropped (M-8) while the rest of the rods in SBE transitioned from 258 to 252/246 on Digital Rod Position Indication (DRPI). Rod motion was stopped and while validating the dropped rod, a second rod in SBE dropped (D-8). At 09:41, once both dropped rods were validated by diverse indications of power, flux, and rod positions, a manual reactor trip was performed.

This event resulted in a reactor trip from 100% power. The Unit was stabilized in Mode 3 with all systems necessary to maintain shutdown conditions, remove decay heat, control the release of radioactive material, and mitigate the consequences of an accident available.

Troubleshooting identified that the problem was isolated to the Rod Holdout Mode Selector (RHMS) switch in Rod Control Power Cabinet SCDE. This is a five-position, seven deck rotary Grayhill switch used to interface with the Rod Holdout Sequencing card and other power cabinet components to accomplish the rod lockout function for rapid refueling. Switch Pin 7 to common C2 on deck F was found to have a high resistance (~300Mohms) while in the "OFF" position.

NRC FORM 366A	LICENSEE EVENT I	•	R) U.S. N	U.S. NUCLEAR REGULATORY COMMISSION		
1. FACILITY NAME	2. DOCKET	6. LER NUMBER			3. PAGE	
Courth Toyon Unit 2	05000499	YEAR	SEQUENTIAL NUMBER	REV. NO	3 OF 4	
South Texas Unit 2	05000499	2013	001	00		

The Rod Holdout Mode Selector switch in Rod Control Power Cabinet SCDE was replaced. To address extent of condition in Unit 2, the four other Rod Holdout Mode Selector switches in the other Rod Control Power Cabinets were tested.

# E. METHOD OF DISCOVERY

The two dropped rods on shutdown bank E requiring a manual reactor trip were self-revealing.

# II. EVENT-DRIVEN INFORMATION

#### A. SAFETY SYSTEMS THAT RESPONDED

All required safety systems responded as expected except that one of two Nuclear Instrument Source Range detectors, N32, did not energize automatically. This was identified and the function performed manually. In addition to failing to automatically energize, the source range audio count rate on N32 also failed to function. These conditions have been entered into the Corrective Action Program.

# B. DURATION OF SAFETY SYSTEM INOPERABILITY N/A

#### C. SAFETY CONSEQUENCES AND IMPLICATIONS OF THE EVENT

There was no impact to radiological safety, safety of the public, or safety of station personnel during this event.

The Incremental Conditional Core Damage Probability (ICCDP) for the Reactor Trip in Unit 2 on 1/4/2013 is 1.12E-07. The resulting Incremental Conditional Large Early Release Probability (CLERP) is 5.92E-08.

# III. CAUSE OF THE EVENT

The cause of this event has been determined to be high resistance circuit on the RHMS from the C (common) contact in switch position 7 on deck F due to contamination. Even though offsite failure analysis did not reproduce the high resistive contact nor did it find evidence of contamination that could have caused this condition, enough evidence exists from other failure analysis and industry experience to conclude that contamination is the cause.

The cause of this contamination could be due to:

- The low current that flows through these contacts is not enough to burn through corrosion/carbon deposits that builds up on the contacts over time.
- Solder flux on contact surfaces.
- Grease or other contaminants.

NRC FORM 366A  LICENSEE EVENT REPORT (LER)  U.S. NUCLEAR REGULATORY COMM  CONTINUATION SHEET						
1. FACILITY NAME	2. DOCKET	6. LER	NUMBER		3. PAGE	
Courth Toyon Unit 2	05000499	YEAR	SEQUENTIAL NUMBER	REV. NO	4 OF 4	
South Texas Unit 2	03000499	2013	001	00		

#### IV. CORRECTIVE ACTIONS

Corrective actions will be implemented in accordance with the STP Corrective Action Program. The Rod Holdout Mode Selector switch in Rod Control Power Cabinet SCDE was replaced. Corrective actions to prevent future failures will include either a design change to address the vulnerability associated with the RHMS switch contacts or replacement of existing switches with newly manufactured switches.

# V. PREVIOUS SIMILAR EVENTS

There have been no similar reportable events at STP within the last three years. The Rod Holdout Mode Selector (RHMS) switches in the Rod Control Power Cabinets interface with the Rod Holdout Sequencing card and other power cabinet components to accomplish the rod lockout function for rapid refueling. There are no previous similar industry events as South Texas Project (STP) is the only plant that uses rapid refueling.

# VI. ADDITIONAL INFORMATION

N/A